

Trees and Construction

BS5837:2012 Tree Survey, Arboricultural Implications Assessment & Method Statement

Site: New Ysgol Plas Brondyffryn, Denbigh Leisure,
Clwyd Avenue, Denbigh, LL16 3HB

Ref: 220286/A2_AIA

Client: Wates Group



(Mail) 2nd Floor | 1 Hunters Walk | Canal Street | Chester | CH1 4EB

0333 123 7080 | info@indigosurveys.co.uk

www.IndigoSurveys.co.uk

Arboricultural Consultant (Author):	Arboricultural Consultant (Checked by):
Tony Banner <i>TechCert (ArborA), TechArborA</i>	Andrew Turnbull <i>FDS Sc MA ArborA</i>

- May 2022 -

TABLE OF CONTENTS

Chapter	Title	Page
1	Introduction	3
2	Site & Application Information	4
3	Findings & Recommendations	5 - 7
4	Scheme / Impact Assessment	8
5	Method Statement 'Considerations'	9 - 11

Appendices

Caveat	I
Terms and Definitions	II
Tree data table, Tree Constraints Plan & Tree Protection Plan	III

Revision	Description	Date
/	/	/

1. INTRODUCTION

- 1.1 **Instruction:** This advice has been prepared for Wates Group (hereafter; client) and is in respect of the tree related planning considerations at New Ysgol Plas Brondyffryn, Denbigh Leisure, Clwyd Avenue, Denbigh, LL16 3HB (hereafter; site).

As the proposal relates to development works at site, the advice herein is produced in accordance with the British Standard 5837 : 2012 '*Trees in Relation to Design, Demolition and Construction - Recommendations*' (hereafter; BS5837).

- 1.2 **BS5837:** The scope of BS5837 is to provide guidance on how trees and other vegetation can be integrated into construction and development design schemes. The overall aim is to ensure the protection of amenity by trees which are appropriate for retention.

- 1.3 **Scope of this advice:** This advice has been produced in accordance with BS5837 and is secondary to arboricultural guidance as a 'Tree Survey Assessment' ref: 220286/A1 (hereafter; tree report). The tree report was provided to the client, intended to demonstrate the realistic arboricultural constraints and assist with the design process.

This advice is further to the tree report. Hence, the objective is to assess and provide recommendations regarding the proposal's potential impact on trees and vice versa.

- 1.4 Following instruction the consultant surveyed the site on the 1st March 2022 where a site walkover and BS5837 tree survey were carried out; all trees on site and around the application boundary were surveyed from ground level and plotted as either an individual or a tree group.

- 1.5 This advice is subject to caveat at Appendix I, outlines relevant terms and definitions at Appendix II and constitutes the findings of the preliminary site assessment and associated arboricultural recommendations.

- 1.6 The survey data and site observations use the supplied topographical survey to illustrate the surveyed trees in plan format as a 'Tree Constraints Plan' (hereafter; TCP).

The TCP was supplied with arboricultural advice and has an overlay of the proposed scheme to enable review. The TCP informs this assessment and is used as a base layer for the appended 'Tree Protection Plan' (hereafter; TPP); the TCP, tree survey data table and TPP are at Appendix III.

2. SITE INFORMATION & TREE ASSESSMENT

2.1 The site currently comprises an open field as part of the wider Denbigh Leisure centre. The site is bound by the leisure centre to the north, field to the south, Ystrad Road and a public footpath to the east and residential properties to the west.

2.2 **Proposal:** It is understood that a proposed scheme involves the construction of a school at site which will include a general scheme of landscape improvement, parking provision and access improvement onto and around the site. This is confirmed as per the client's proposed site plan as illustrated on the TCP.

2.3 The site requires consideration from an arboricultural perspective due to the presence of trees on and around the site; these trees are deemed to be within impacting distance of the potential construction area.

2.4 The trees -

2.4.1 The tree survey and assessment resulted in the BS5837 quality/retention categories of 'A - high', 'B - moderate' and 'C - low' being attributed to trees/tree groups as well as those categorised as 'U' for either small scale trees or those dead, dying or dangerous trees needing to be removed.

2.4.2 The BS5837 tree survey is a means of objective assessment and reflects the trees' condition, quality contribution, remaining life expectancy and spatial considerations (stem, crown and roots). On this basis and in order to consider the trees' accurate constraints, the survey data has the crown extents for north, east, south and west, the stem diameter measurement, and the calculated root protection areas (hereafter; RPAs). Hereafter, the trees are therefore reviewed and considered on their own merits and in line with the guidance of BS5837.

2.4.3 There are identified defects to the surveyed trees, this has resulted in the recommendation for tree removal, i.e. the category 'U' trees. Thereafter, general site inspections and tree works will be required for H&S tree risk management.

3. FINDINGS & RECOMMENDATIONS

3.1 The following information, as with the prior contents of this report, should be read with the appended tree data table and tree constraints plan (220286/TCP/01).

NOTE: This information as s.3 for the '*tree survey assessment*' is included as an objective and general overview of the trees and consideration for retention and protection. It is included herein for reference and context and is supplemented with a review of the scheme as the AIA (section 4) and the AMS 'considerations' (section 5).

3.2 General Considerations for Tree Retention / Removal

3.2.1 Due to the poor condition and defects noted to the trees categorised as 'U', it is recommended that T4, T12 and G1 be removed as part of H&S tree management.

3.2.2 There are smaller scale trees and those with defects or limitations on the current amenity contribution or useful remaining life expectancy, these are categorised as 'C - low'.

These 'C' category trees should not constrain nor significantly guide a scheme, although protection may be preferable to retain landscape function and maturity. For any proposed tree removals, mitigation tree planting is recommended as part of a landscape scheme and can suitably replace and enhance the initial loss of canopy cover.

3.2.3 The moderate quality 'B' category trees are noted as such due to their fair future potential and fair current amenity contribution. These should be retained and protected where possible as part of the site's development.

3.2.4 The most notable tree, based on individual prominence, lack of significant defects, current contribution and future potential, is categorised 'A - high'. It is recommended that T3 be retained and protected.

3.3 Tree Protection

3.3.1 The design and layout of the site is to incorporate the essential components of retained trees (crown and rooting area) and provide a suitable level of clearance to allow for their long term safe retention, i.e. RPA protection and crown clearance as well as for any new tree(s) being planted.

3.3.2 Depending on the level of tree retention/removal, the protection methods for the retained trees is likely to vary. However, it is likely that a combination of construction restrictions be used with protective barrier fencing (to protect RPAs).

The process of site operations will be an important aspect to confirm by way of a construction layout plan, i.e. showing storage areas, parking, delivery area, access routes etc., all outside of RPAs or with a provision for ground protection. As a basis for tree protection the following points will need to be considered:

- Removal of all agreed trees and any agreed pruning works prior to works commencing by a suitably qualified arboricultural contractor;
- Induction of construction personnel regarding the exclusion of works (including access and storage) from the retained trees' RPAs;
- Secure temporary barrier fencing around the site to exclude the retained tree's crowns and RPAs from the working site;
- The storage of materials clear of all retained trees and conditions to ensure no contamination/run-off into soils in proximity to trees or on higher ground; and
- For the removal of existing structures and/or hard surfaces from RPAs the works to be undertaken separate to construction, manually and sensitively.

3.4 General Overview

3.4.1 The considerations for trees which are to be retained as part of the proposal need to be addressed in order to ensure their protection. This is to account for the potential impact on retained trees and their growing environment from the proposed development and vice versa (these follow).

Tree Works

Any trees which are to be removed should be well indicated to ensure that the retained trees are suitably protected. Hence, all trees which are to be removed are to be marked by a suitably qualified person [spraying the stems with a cross] prior to tree works.

Tree Crowns

Consideration is required for both existing and newly planted trees whereby the proposed construction should take account of trees reaching their full growth potential. It is always prudent to provide adequate clearance from a tree's current crown for future growth, i.e. to allow a tree adequate space to reach maturity without conflicts with new structures.

Root Protection Areas (RPA)

As a minimum it would be suitable to consider the outer extents of retained trees' RPAs as construction exclusion zones and be protected.

As above, it is *sometimes* possible to undertake construction activities within the rooting areas of retained trees which requires greater attention to tree protection, foundation designs, phasing of works etc. If it is proposed to undertake works within these areas,

more specific advice should be sought from a qualified arboriculturalist with a view to assessing the feasibility of said proposal and forming a suitable method statement.

Demolition/Excavation Works

Any removal of existing built structures (including stairways, small outbuildings, retaining walls etc.) or hard surfacing will need to be undertaken with great care where this occurs within or near to the anticipated rooting areas of retained trees.

Said works should adhere to the RPA restrictions, be undertaken manually with hand held non mechanical tools and ensure that existing ground levels are retained.

Hard Landscape Works

As with previously mentioned arboricultural restrictions to demolition/construction, the proposed works should avoid retained trees' RPAs. However, where ground works are proposed within RPAs, construction methods [for hard surfacing, walls etc.] should retain the existing ground levels, be undertaken sensitively and using a no dig design.

Conversion of soft surfaced areas within RPAs to hard surfaced walkways, parking areas etc., will need to utilise a no-dig product to ensure no negative impact on the tree roots and/or growing conditions.

- 3.4.2 For any proportion of tree removal, new tree planting is to be integrated into a landscape scheme. The new trees should be of a suitable volume, species, scale, in suitably prepared planting locations with adequate space for future growth and development and enhance the site's long term amenity contribution.
- 3.4.3 Further to the above information, the proposed scheme (see; TCP) is reviewed hereafter at s.4 as an Arboricultural Implications Assessment (hereafter; AIA).

4. SCHEME / IMPLICATIONS ASSESSMENT

- 4.1 For the purpose of this assessment, the proposed site plan is used as a basis for consideration. This takes account of anticipated tree removals, tree protection options and potential alterations to account for arboricultural features; as per s.1.6 and s.2.2 herein, the TCP shows the ‘*proposed site plan*’ as an overlay for review.
- 4.2 As per s.3.2.1, based on the poor condition and limited future potential of the ‘U’ category trees T4, T12 and G1, it is recommended these trees be removed as part of health and safety tree risk management.
- 4.3 The proposed new parking encroaches the RPA of the ‘A’ category tree T3. Whilst this incursion is minor and at the outer extents of the RPA, it is recommended to use a tree-root sensitive, no-dig design to minimise the impact on the RPA’s and ground i.e., retain the existing soil level, use a load bearing cellular confinement system (e.g. Cellweb or similiar) and preferably a permeable surface treatment.
- 4.4 The proposed cycle store encroaches the RPA of the ‘C’ category tree T2. This incursion is very minor and at the outer extents of the RPA, hence, the impact is considered negligible and therefore no specialist design is required for the cycle store, although manual works are recommend.
- 4.5 Following the above considerations for trees and noted tree works, the trees are clear of the active construction area. However, the installation of temporary tree protection will be required to ensure no impact on trees from access, vehicles, material storage etc.
- 4.6 Further to the above, the following tree works are required prior to site works.

TREE WORK SUMMARY

NUMBER	TREE REMOVALS / PRUNING WORKS	
T4, T12 and G1	Remove	Remove in conjunction the scheme.
Retained trees		Protection by placement of fixed Heras panels around the crown/RPA extents, to have no access during construction.

- 4.7 Further to the above review and in consideration for the tree removals and need to protect retained trees, the following section contains said details as an Arboricultural Method Statement (Application Stage).

5. METHOD STATEMENT (Application Stage)

5.1 Arboricultural Construction Restrictions

5.1.1 The following restrictions are considered relevant for tree protection purposes which are illustrated on the appended Tree Protection Plan:

- a) Tree works; are to be completed prior to any and all site works: additional tree works (or leaning against or attaching of objects to a tree) are not permitted unless agreed in writing by the council.
- b) Protective Barrier Fencing (hereafter; PBF); is to be installed around the retained trees immediately after the tree works and prior to the site works commencing.
- c) Construction Exclusion Zone (hereafter; CEZ); following the installation of PBF the fenced off section is to act as a CEZ and be supplemented with ground protection for RPA sections outside of fenced off areas as the CEZ.
- d) Material Handling; no chemicals / materials are to be transported / stored / used / mixed within exposed grounds on site; all chemical / cement storage, transport or use will be pre-prepared with impermeable liner and detail within a Construction Management Plan.
- e) Site Management; no fires are to be lit and no machinery, plant or vehicles are to be washed down within 10m of a tree's canopy, within a RPA / CEZ, and the RPA / CEZ may not be breached, i.e. no mechanical digging or scraping is permitted within a RPA / CEZ.
- f) Sensitive Landscape; only following construction completion can the PBF be removed and any remaining soft landscape works be undertaken (ground levels to be retained within RPAs and works undertaken manually with non-mechanical hand tools).

5.2 Arboricultural Site Monitoring / Supervision

5.2.1 The site should be checked by a qualified arboriculturist throughout the construction processes to ensure the tree protection measures are adhered to, thus -

- (a) pre-commencement to confirm tree removals;
- (b) after PBF installation;
- (c) during construction to ensure adherence to this AMS; and
- (d) prior to removal of site hoarding after construction completion to sign off the site for correct tree protection and planting.

5.3 Protective Barrier Fencing (PBF) Specification

5.3.1 In this instance, the existing boundary fencing is considered robust and adequate protection for the retained trees. If the boundary fence is to be removed, then temporary barrier fencing is to be installed (and signed off by way of arboricultural supervision) following the completion of the tree works. It is illustrated on the Tree Protection Plan and is to remain in situ for the entire duration of preparation / construction processes unless otherwise agreed in writing by the council.

5.3.2 The temporary barrier fencing, if required, is to consist of a series of Heras panels secured in place by driven scaffold posts or a scaffold frame to ensure that the fencing lines are well braced to resist impact, and site hoarding around the application boundary to prevent access to the RPA / CEZ areas around the approved works.

5.4 Underground utilities

5.4.1 Underground utilities are to be installed as per a dedicated plan and be clear of RPA by design. Otherwise, and if RPAs cannot be avoided, the following restrictions are recommended for underground utilities within RPAs:

- Any necessary excavations to be undertaken sensitively using either a no-dig method (e.g. Air-Spade) and /or under arboricultural supervision;
- Any exposed roots shall be packed with a clean damp sand (not builders sand) and wrapped in hessian sacking to protect them;
- Small roots which are identified (those less than 25mm diameter) may be carefully pruned back with a clean sharp tree saw; and
- Larger roots which are identified (those greater than 25mm in diameter) are to be retained and protected as they may be necessary for a tree's health and stability.

5.5 Sensitive Ground Works within RPAs (new hard surfaces)

5.5.1 The proposed new parking is within retained trees' RPAs, and will require sensitive installation methods to minimise ground and RPA impact.

5.5.2 Any excavations within a RPA or designated CEZ (the area enclosed by PBF) must:

- Use sensitive excavation techniques to protect the tree roots and their existing growing conditions i.e., prepare grounds manually stripping the existing surface, or soil surface and turf only, retain soil levels, use load bearing system (Cellweb or similar), manual installations and a permeable surface treatment.

5.6 Landscape Detail

5.6.1 The finer details of the site landscaping proposals are to be illustrated on a landscape plan. This is to include the exact proposals for hard and soft landscaping together with the details for any new trees' planting locations, species and stock selection, installation and maintenance; this is to be undertaken by the appointed landscape architect who will have the full support of the arboricultural consultant where required.

5.7 Report Handling

5.7.1 This report is released to the client and architect to be distributed at their discretion and the consultant is available for queries relating to this report and /or trees.

5.7.2 The proposed scheme is reviewed in respect of the arboricultural constraints and is considered to be achievable in line with the BS5837 guidance. The recommendations herein may be approved by the council as a means of authorised tree works and tree protection, for which the planning approval will be subject to a final and detailed Arboricultural Method Statement based on the approved information and other detail perhaps not available at the pre-planning approval stage, i.e. utility layout, final landscape plan, construction management plan (CMP) etc.

5.7.3 This AMS and the TPP may be approved by the council in support of the application, subject to a conditioned final AMS and TPP as a means of authorised tree protection measures; all site personnel will have access to a copy and the tree work and protection details are to be inspected as per s.5.2 for '*Arboricultural Monitoring / Supervision*'.

This concludes our advice.

Caveat

Any and all information supplied to Indigo Surveys Ltd by/on behalf of the client is assumed to be accurate unless otherwise informed. | This advice is limited to the observations made on the date of inspection as detailed herein and any deletion, editing or alteration will result in the advice being null and void in its entirety. | This advice in its entirety may be deemed null and void if remedial works are undertaken on any area of the site, on or after the date of the survey. | No liability is assumed by the author or by Indigo Surveys Ltd for any misuse, misinterpretation or misrepresentation of this advice. | This advice is not valid in adverse or unpredictable weather conditions or for any failure due to 'force majeure' or unpredictable events. | No responsibility is assumed either by the author of this advice or by Indigo Surveys Ltd for any legal matters that may arise as a consequence. | Neither the author nor Indigo Surveys Ltd will be required to attend court or give testimony as part of this agreement. | The responsibility for any works undertaken on the basis of the recommendations of this advice does not form part of this agreement.

Appendix II

Terms and Definitions

“Arboriculturist” - person who has, through relevant education, training and experience, gained expertise in the field of trees in relation to construction.

“Competent Person” - person who has training and experience relevant to the matter being addressed and an understanding of the requirements of the particular task being approached.

“Topographical survey” - an accurately measured land survey undertaken to show all relevant existing site features. *A method of carrying out topographical surveys is given in RICS specification Surveys of land buildings and utility services at scales of 1:500 and larger.*

“BS5837 Tree survey” - should be undertaken by an arboriculturist to record information about the trees on or adjacent to a site. The results of the tree survey, including material constraints arising from existing trees that merit retention, should be used (along with any other relevant baseline data) to inform feasibility studies and design options. For this reason, the tree survey should be completed and made available to designers prior to and/or independently of any specific proposals for development.

“Tree categorisation method” - trees should be categorised in accordance with the BS5837 cascade chart by an arboriculturist. This is to identify the quality and value (in a non-fiscal sense) of the existing tree stock, allowing informed decisions to be made concerning which trees should be removed or retained in the event of development occurring.

“Root protection area (RPA)” - layout design tool indicating the minimum area around a tree deemed to contain sufficient roots and rooting volume to maintain the tree’s viability, and where the protection of the roots and soil structure is treated as a priority, shown as an arboricultural constraint in m². The radius is calculated using the BS5837 calculation method. An arboriculturist may change the shape of an RPA but not reduce its area.

“Arboricultural implications assessment” - a study, undertaken by an arboriculturist, to identify, evaluate and possibly mitigate the extent of direct and indirect impacts on existing trees that may arise as a result of the implementation of any site layout proposal.

“Arboricultural method statement” - methodology for the implementation of any aspect of development that is within the root protection area, or has the potential to result in loss of or damage to a tree to be retained.

“Tree protection plan” - a scale drawing, informed by descriptive text where necessary, based upon the finalised proposals, showing trees for retention and illustrating the tree and landscape protection measures.

Appendix III

Data Table:	As appended (BS5837 Tree Survey Key & Table)
Tree Constraints Plan:	As appended (220286/TCP/01)
Tree Protection Plan:	As appended (220286/TPP/01)

TREE SURVEY IN ACCORDANCE WITH BRITISH STANDARD 5837:2012 'TREES IN RELATION TO DESIGN, DEMOLITION & CONSTRUCTION - RECOMMENDATIONS'

CLIENT: Wates Group

PROJECT REF: 220286/A1

SITE: New Ysgol Plas Brondyffryn, Denbigh Leisure, Clwyd Avenue, Denbigh, LL16 3HB

CONTACT: /

SURVEY DATE: 1 March 2022

ARB CONSULTANT: Andrew Turnbull FDSc MA ArborA

TREE REF. #	SPECIES	AGE	HEIGHT (in m)	CANOPY (in m) N - S - E - W				STEM (in mm)	RPA (in m)	CLEARANCE (in m)	1st BRANCH (in m)	VITALITY	LIFE EXPEC.	NOTES	BS CAT.	MANAGEMENT
T1	Ash; Fraxinus, Oleaceae	EM	8	2	3	3	3	230	2.8	3	3m - all round	Normal	40 +	Fair form and future growth scale / potential, under high flood light.	C 2	
T2	Oak; Quercus, Fagaceae	LM	7	5	12	5	7	1200	14.4	2.5	2.5m - S.East	Fair	10 - 20	Lost crown leaders x3, wide lateral extension of remaining 2x limbs, Ganoderma at base.	C 3	Lateral reduction of remaining 2x laterals by 50% their length, i.e. 33-4m canopy extents.
T3	Oak; Quercus, Fagaceae	M	15	10	11	12	10	870	10.4	2	3m - North	Normal	40 +	Major deadwood, hangers, multiple stem crown, some historic branch loss in crown to West (large).	A 3	Crown clean (remove dead, dying and crossing branches).
H1	Mixed hedge (predominantly Hawthorn)	M	< 1.5	/	/	/	/	/	/	0	/	Normal	20 - 40	Some Holly and Elder in Hawthorn hedge.	C 2	
T4	Ash; Fraxinus, Oleaceae	EM	10	3	4	3	4	410	4.9	2	union	Poor	< 10	On bank, failed co-dominant union at 0.5-2.0m.	U	Fell and poison stumps.
T5	Ash; Fraxinus, Oleaceae	EM	10	4.5	4.5	4.5	4.5	381	4.6	1	union	Fair	20 - 40	4x stems (170mm, 190mm, 200mm, 200mm), on bank, multiple stems at 0.5m.	C 3	
T6	Poplar; Populus, Salicaceae	M	20	9	8	8	7	600 *	7.2	4	6m - East and West	Normal	40 +	Ivy covered stem, minor bench snap outs.	B 3	
T7	Sorbus, Rosaceae	M	8	4	4	4	4	450	5.4	2	union	Fair	10 - 20	Multiple stems at 1.5m+, dense canopy.	C 3	
T8	Ash; Fraxinus, Oleaceae	M	9	6	4	7	5	636	7.6	2	3m - N.East	Fair	10 - 20	2x stems (450mm, 450mm), co-dominant at 0.5m (obscured), low visor and dense ivy to structure, larger stumped limb to South.	C 3	Ivy management (sever Ivy from base and stem) and monitor tree's condition.
T9	Sycamore; Acer, Aceraceae	SM / M	12	6	6	6.5	5	610	7.3	3	union	Fair	20 - 40	Multiple stems at 2m+, tight unions, included bark.	B 2	
T10	Sycamore; Acer, Aceraceae	SM	12	7	6	8	7	500	6.0	3	4m - all round	Fair	40 +	Wide spread, limbs removed over path and paddock, deadwood throughout.	B 3	
T11	Horse Chestnut; Aesculus, Aesculaceae	SM	10	6	4	5	5	510	6.1	2.5	2.5m - North	Fair	10 - 20	Snapped and removed limbs to paddock, contorted growth, fair remaining form.	C 2	Monitor tree's condition.
T12	Sycamore; Acer, Aceraceae	EM	8	3	3	4	3	320	3.8	1	2m - all round	Poor	< 10	Multiple stems at 1.5-2.0m, topped with reaction growth, poor form and structure.	U	Fell and poison stumps.
G1	Ash; Fraxinus, Oleaceae	Y	6-8	/	/	/	/	< 200	/	0	/	Poor	< 10	Offsite, self set growth touching fence and single storey structure.	U	Fell and poison stumps.

TREE SURVEY IN ACCORDANCE WITH BRITISH STANDARD 5837:2012 'TREES IN RELATION TO DESIGN, DEMOLITION & CONSTRUCTION - RECOMMENDATIONS'

CLIENT: Wates Group

PROJECT REF: 220286/A1


SITE: New Ysgol Plas Brondyffryn, Denbigh Leisure, Clwyd Avenue, Denbigh, LL16 3HB

CONTACT: /

SURVEY DATE: 1 March 2022

ARB CONSULTANT: Andrew Turnbull *FDS* *MArborA*


TREE REF. #	SPECIES	AGE	HEIGHT (in m)	CANOPY (in m) N - S - E - W	STEM (in mm)	RPA (in m)	CLEARANCE (in m)	1st BRANCH (in m)	VITALITY	LIFE EXPEC.	NOTES	BS CAT.	MANAGEMENT
TREE SURVEY 'KEY' - BRITISH STANDARD 5837:2012 'TREES IN RELATION TO DESIGN, DEMOLITION & CONSTRUCTION - RECOMMENDATIONS'													
	TPO/CA	-	On client request: presence of Tree Preservation Orders (TPO) / site location within a Conservation Area (CA) & date checked;										
	TREE REF. #	-	Tree reference number: tag or plan number (T - individual tree, G - group of trees/shrubs, H - hedge);										
	SPECIES	-	Genus, species and/or common name;										
	AGE	-	Age classification (NP - new planting, Y - young, EM - Early-Mature, SM - semi mature, M - mature, LM - late mature, OM - over mature);										
	HEIGHT (in m)	-	Approximate height of tree in metres;										
	CANOPY (in m) N - S - E - W	-	Approximate branch spread in metres of the four principal compass points;										
	STEM (in mm)	-	Stem diameter in millimetres: measured in accordance with s.4.6 of BS5837;										
	RPA (in m)	-	Circle radius of the Root Protection Area: calculated using the stem diameter (single/multiple stem variant, as outlined within BS5837);										
	CLEARANCE (in m)	-	Crown clearance in metres above the adjacent ground level;										
	1st BRANCH (in m)	-	Clearance in metres to first significant branch and direction of growth (where relevant);										
	VITALITY	-	Physiological condition typically gauged from canopy cover and annual extension growth (good, fair, poor, dead);										
	ESTIMATED REMAINING CONTRIBUTION	-	Approximate number of years a tree will continue to contribute without the need for oppressive arboricultural intervention, categorised in years as <10, 10-20, 20-40 and >40;										
	NOTES	-	Structural and physiological condition observations;										
	BS CAT.	-	BS5837 tree quality assessment category: resulting from structural/physiological condition and remaining contribution (approximate useful life expectancy); Standard retention category U : in such a condition that any existing value would be lost within 10 years; Standard retention category A : high quality and value, in such a condition as to be able to make substantial contribution of 40+ years; Standard retention category B : moderate quality and value, in such a condition as to make a significant contribution of 20+ years; Standard retention category C : low quality and value, currently in adequate condition to remain until new planting could be established 10+ years; Standard retention sub-category, mainly due to: 1 - Arboricultural values, 2 - Landscape values, 3 - Cultural values, including conservation;										
	MANAGEMENT	-	Preliminary management recommendations (as appropriate);										
	***	-	Within the survey schedule denotes an estimate										

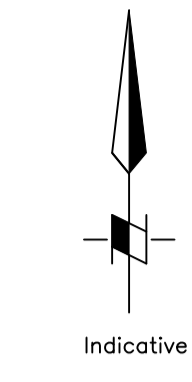

KEY

- Tree Crown Spread
- Root Protection Area (RPA)
- Tree Stem
- T1 Tree No.
- Tree Condition Category**
- A
- B
- C
- U


The surveyed trees are illustrated on this Constraints Plan which is prepared in accordance with British Standard BS5837: 2012 'Trees in Relation to Design, Demolition and Construction - Recommendations'

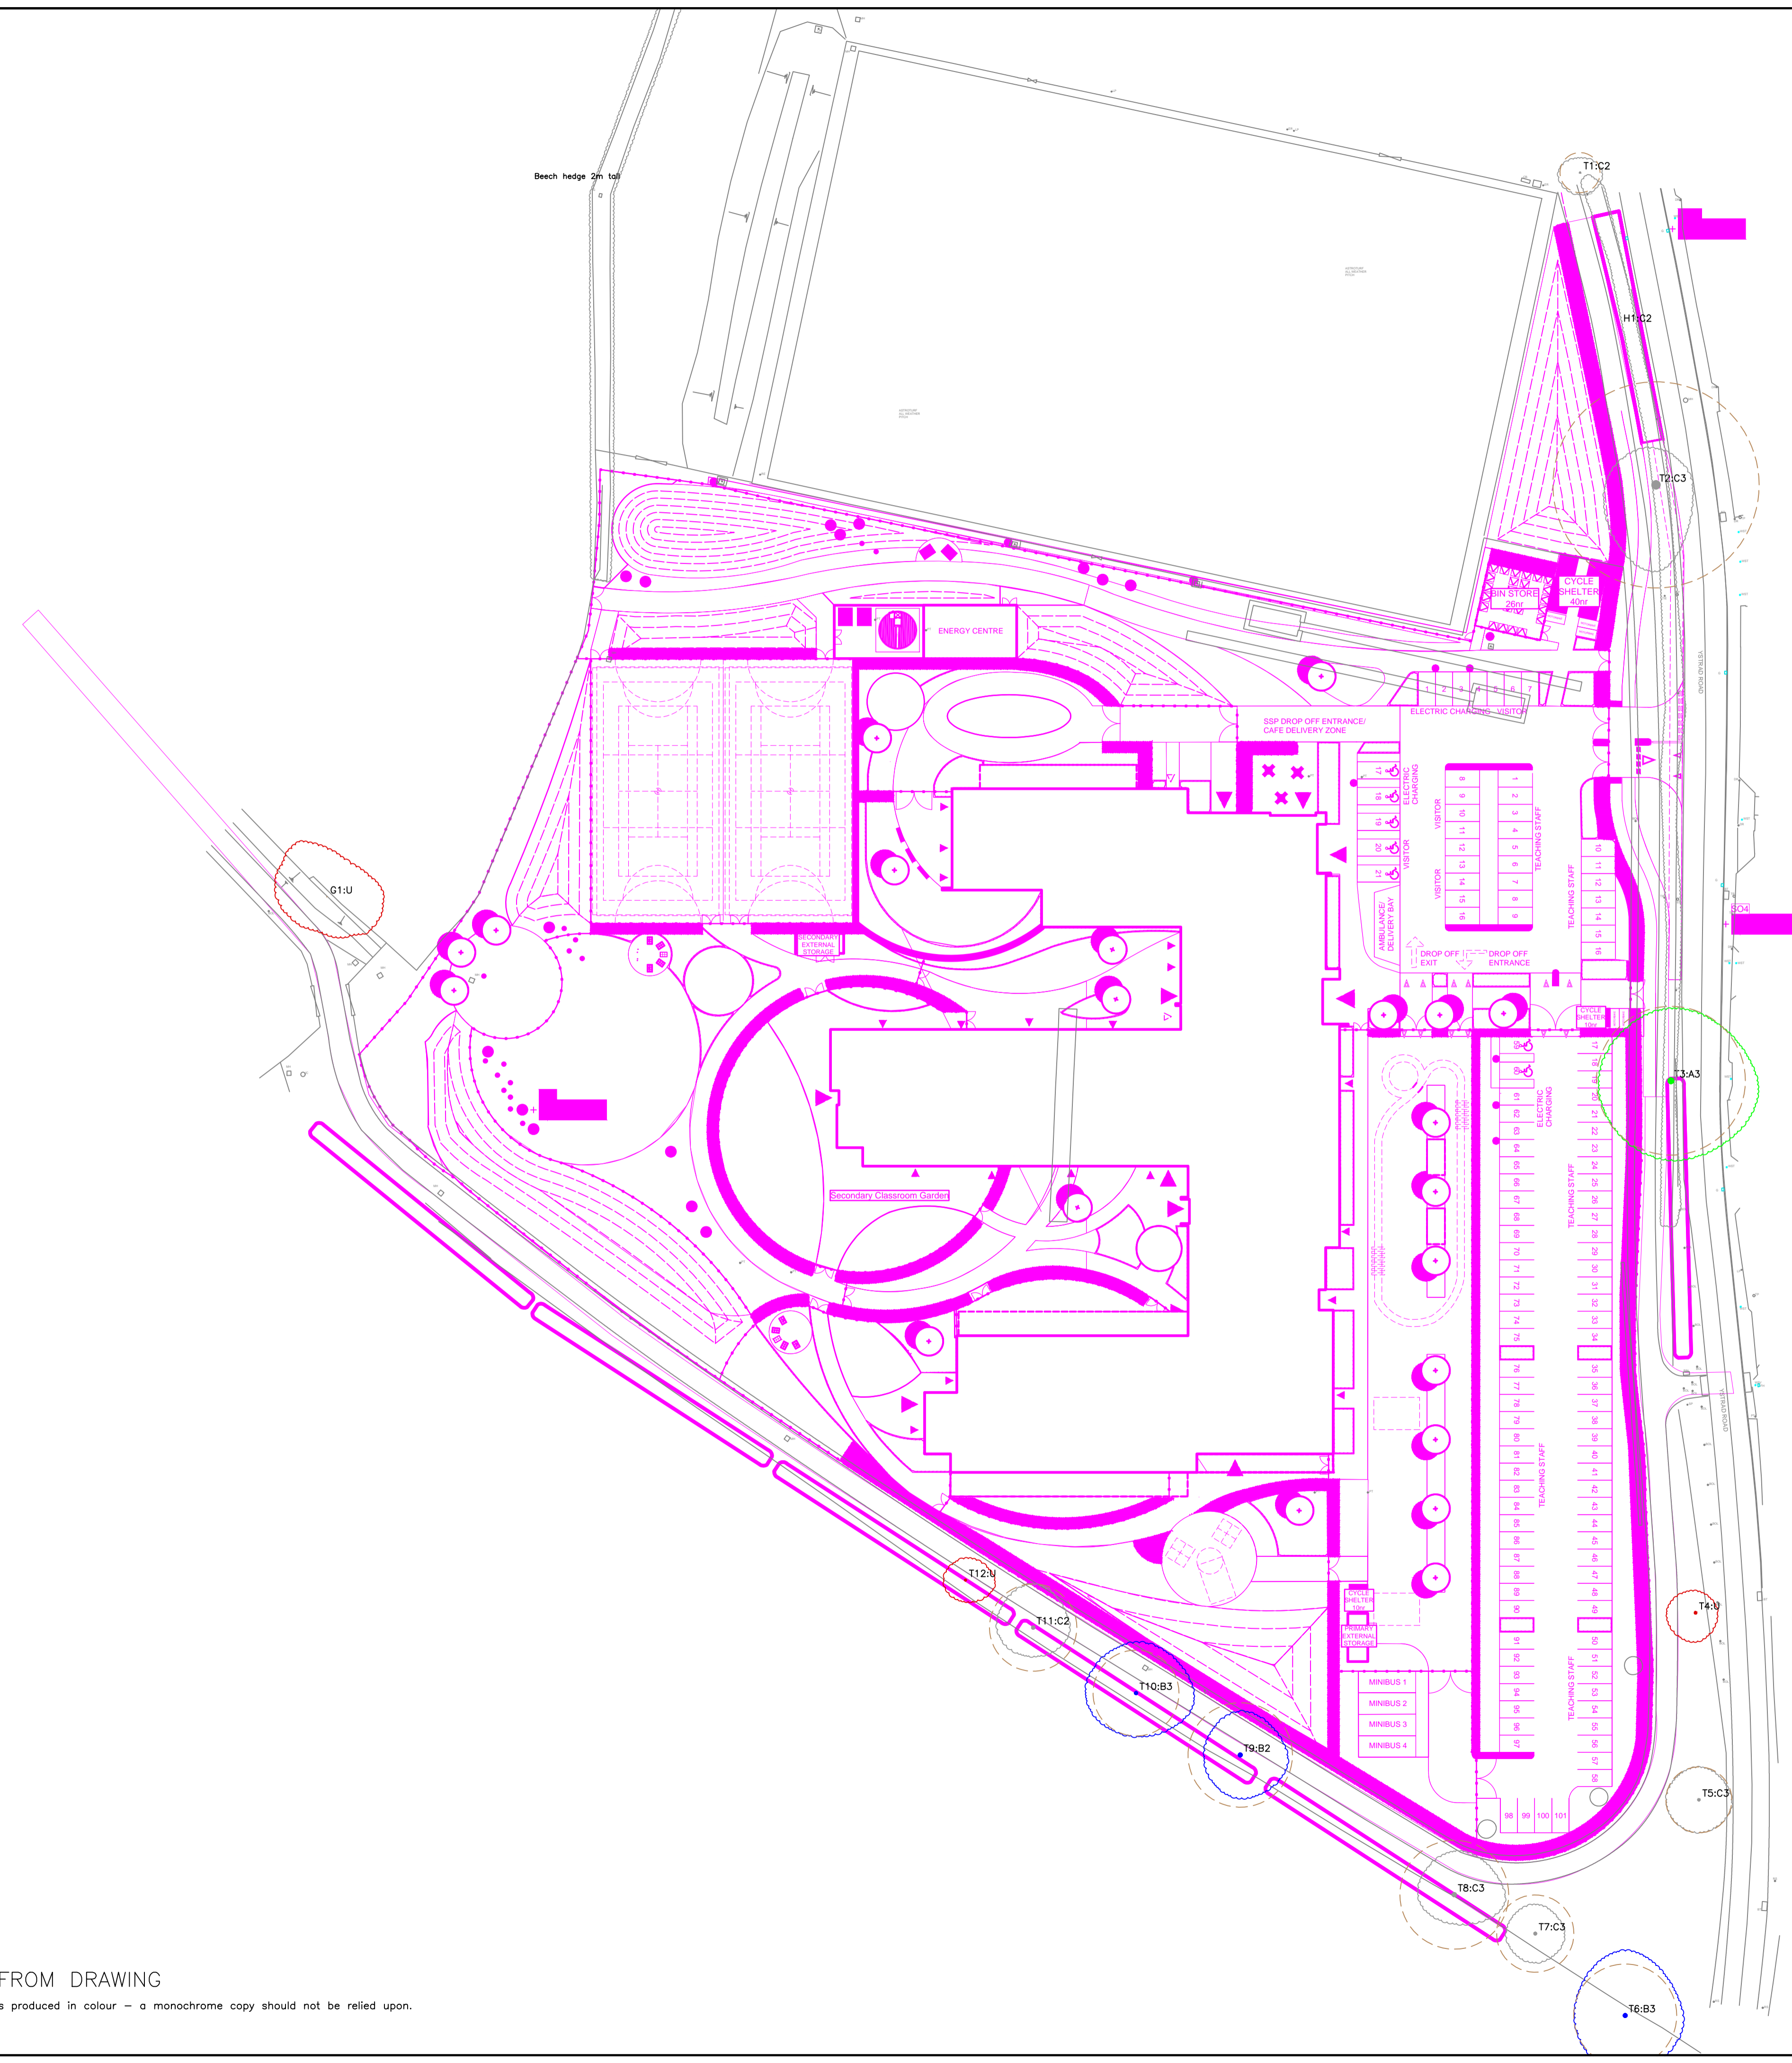




DO NOT SCALE FROM DRAWING
The original of this drawing was produced in colour - a monochrome copy should not be relied upon.

REV.	DESCRIPTION	DWN	CHK'D	DATE		
CLIENT Wates Group						
PROJECT 220286/A1 New Ysgol Plas Brondyffryn, Denbigh Leisure, Ciwyd Avenue, Denbigh, LL16 3HB						
TITLE Tree Constraints Plan						
DWN	DATE	CHK'D	DATE	APP'D	DATE	SCALE
RCK	01/04/2022	TB	01/04/2022			1:500
<small>(Mail) Second Floor, 1 Hunter's Walk, Canal Street, Chester, CH1 4EB Telephone: 0333 123 7080 www.indigosurveys.co.uk</small>						
Drawing Number						
220286/A1/TCP/01						
				REV.	A1	
THIS DRAWING IS CONFIDENTIAL AND MUST NOT BE REPRODUCED WITHOUT THE CONSENT OF INDIGO SURVEYS LTD.						

Protective Barrier Fencing - Example Design

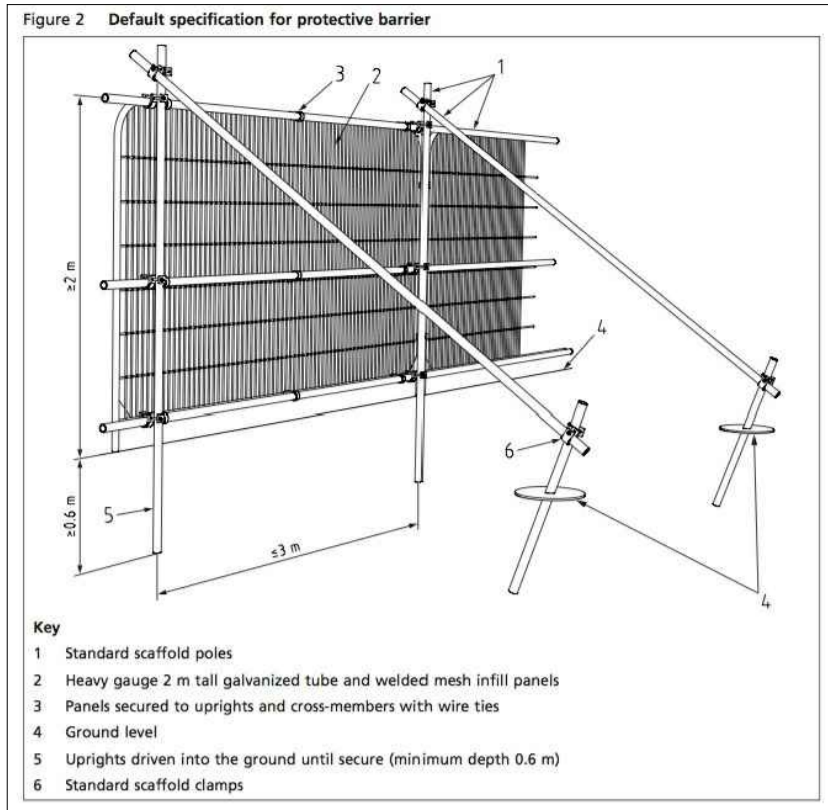

(c) British Standards Institute (www.bsigroup.com)

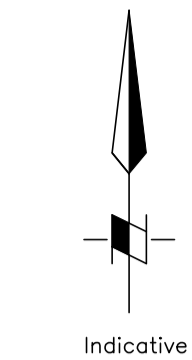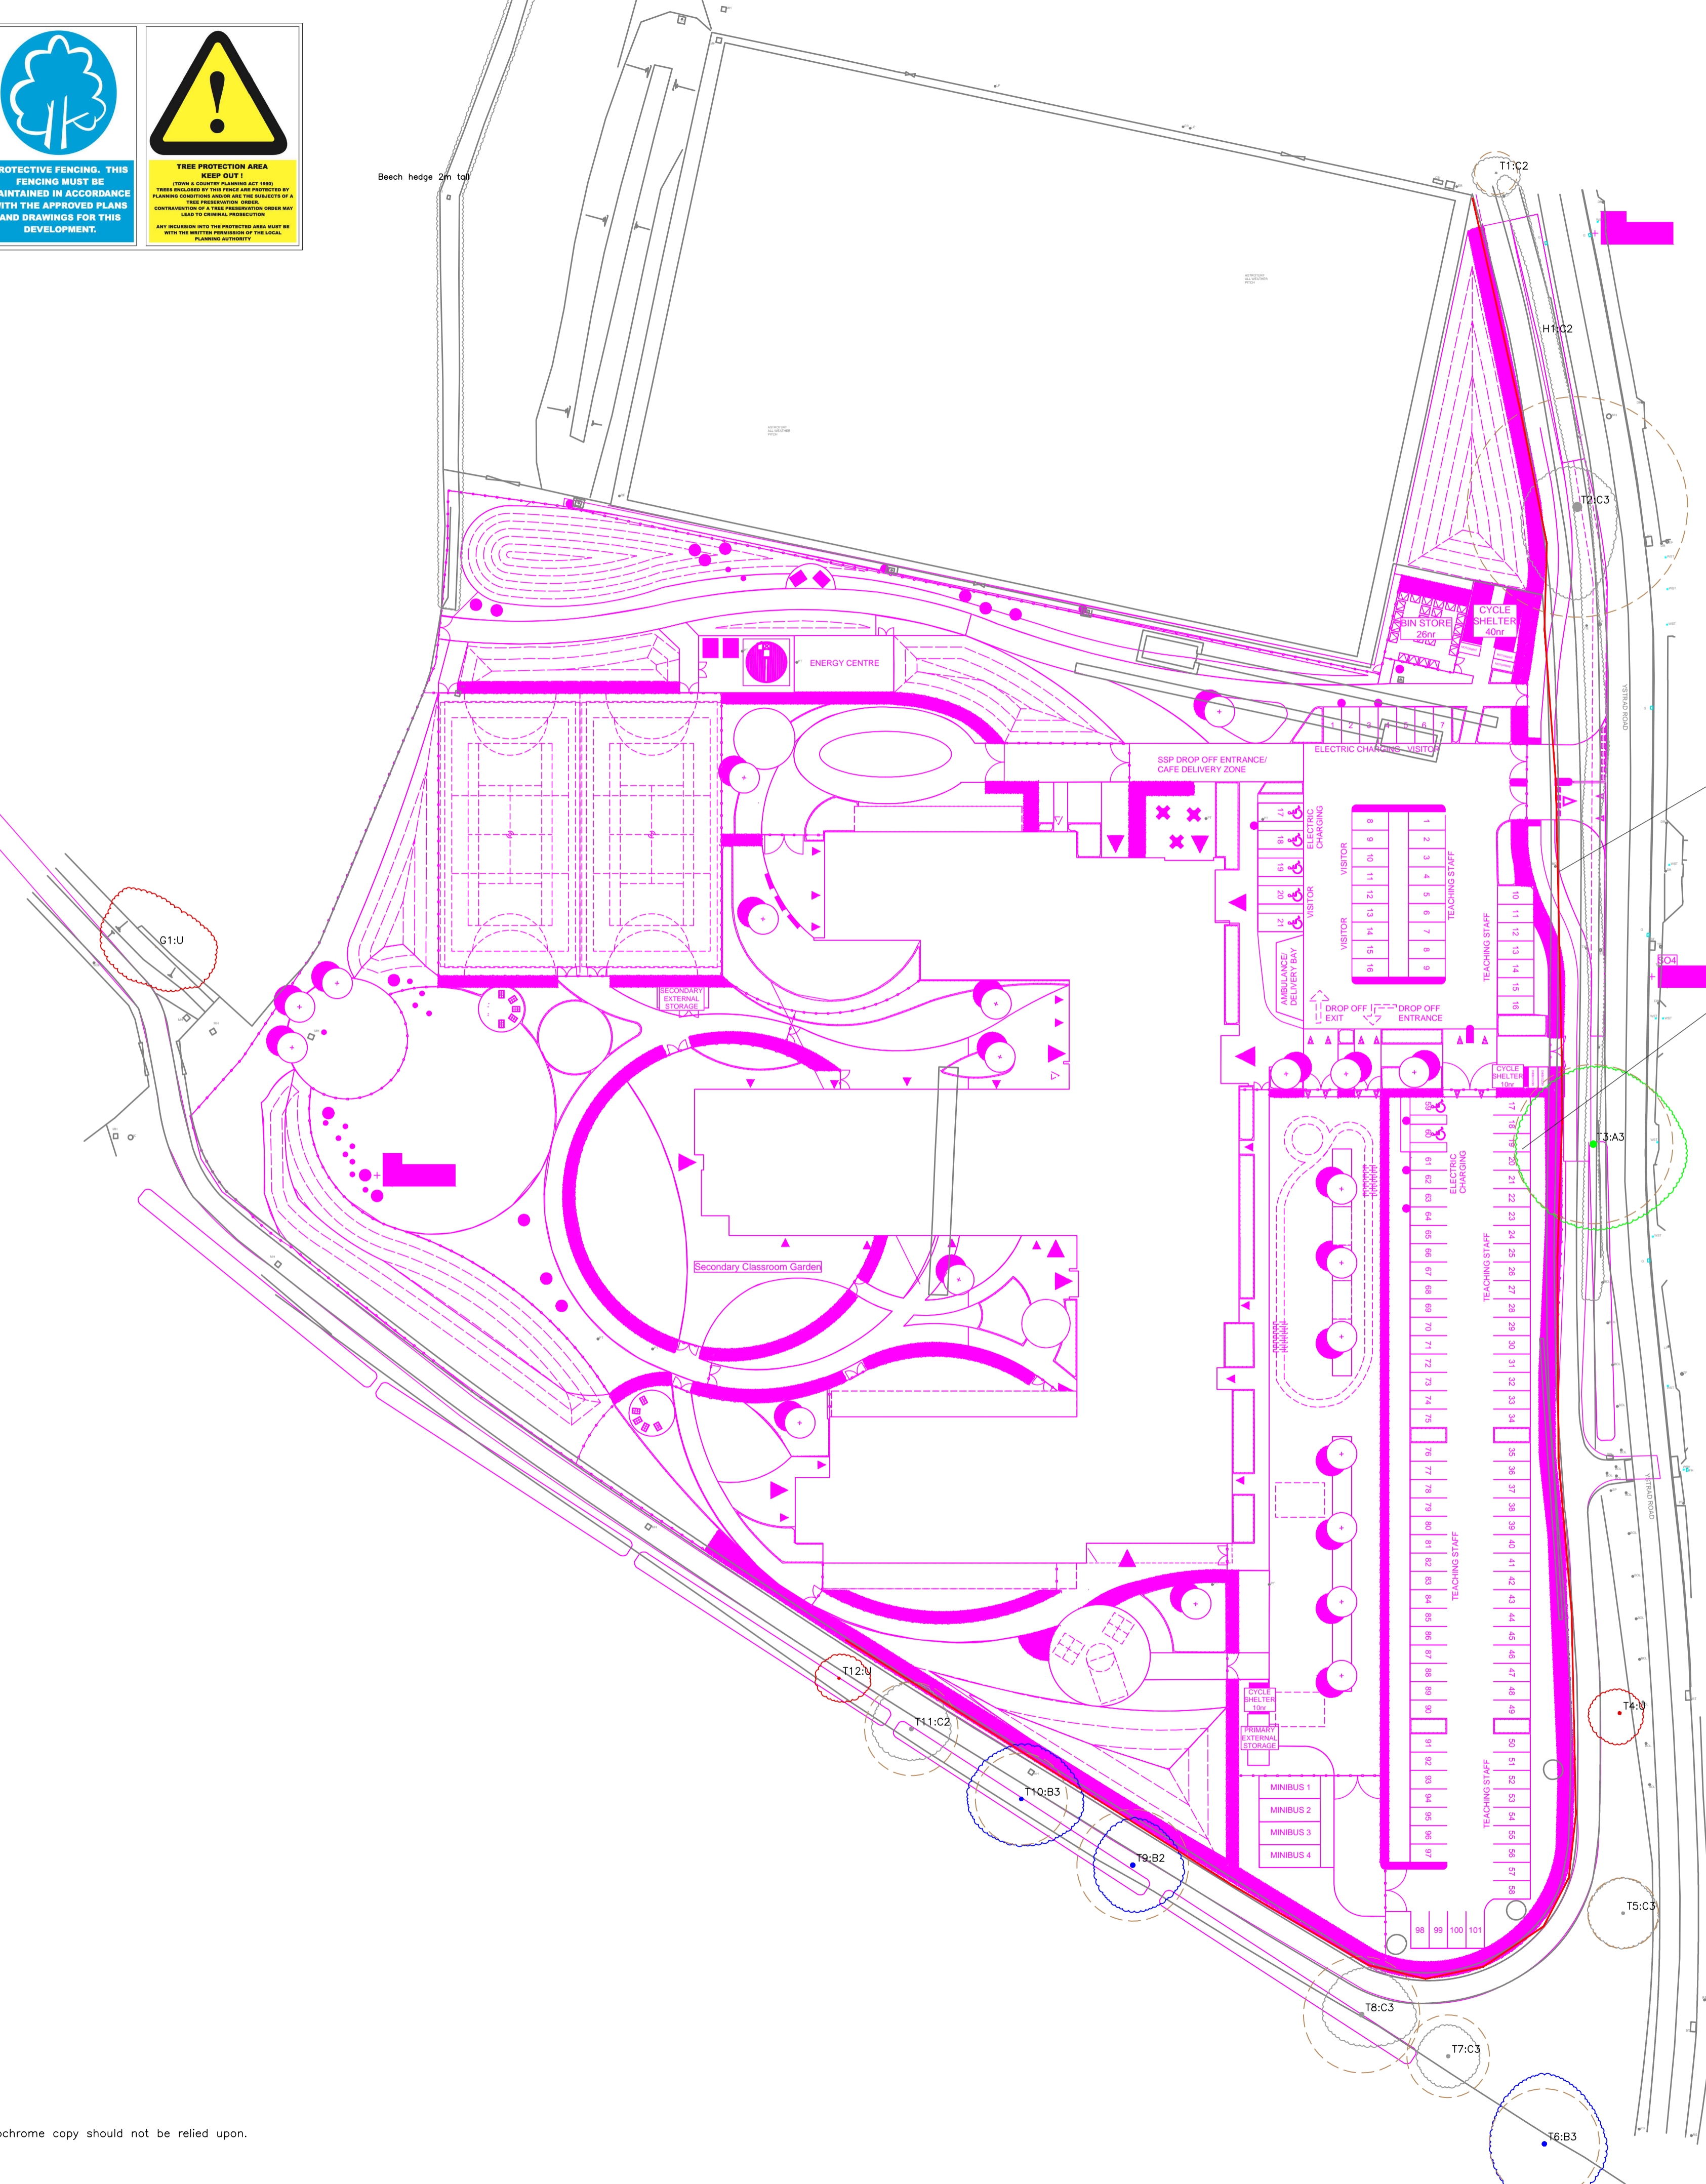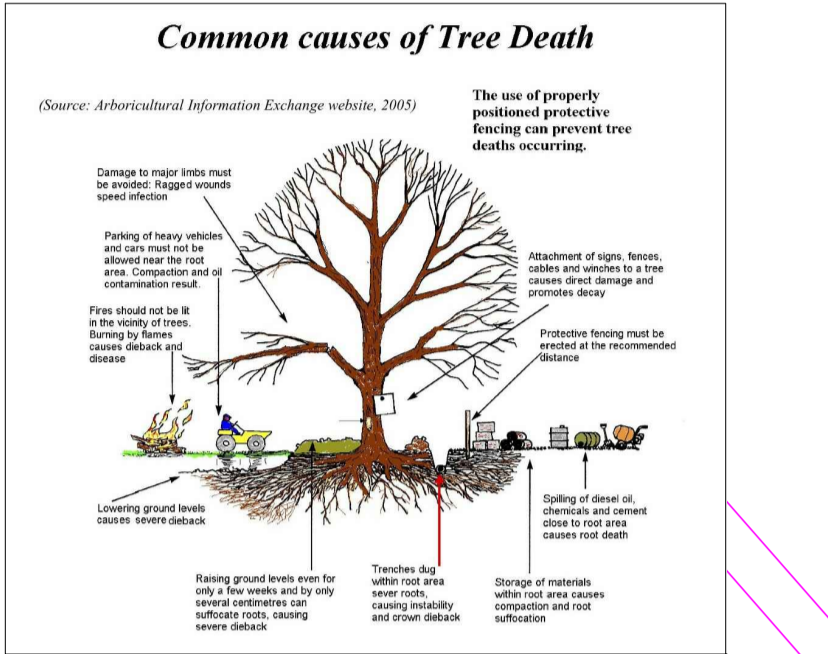

KEY

- Tree Crown Spread
- Root Protection Area (RPA)
- Tree Stem
- T1 Tree No.

Tree Condition Category

- A
- B
- C
- U

The surveyed trees are illustrated on this Constraints Plan which is prepared in accordance with British Standard BS5837: 2012 'Trees in Relation to Design, Demolition and Construction - Recommendations'

Protective Barrier Fencing (PBF):
The existing boundary fence is to be retained to act as a barrier to protect the trees, if the fence is to be removed, then Heras panels are to be installed (as per the illustration on this plan) with tree protection signs, to be fixed in place for the duration of site works for tree protection and to remain until construction completion..

Sensitive Ground Works - for any new hard surface in the RPA of T3, prepare grounds manually stripping the existing soil surface and turf only, retain soil levels, use load bearing system (Cellweb or similar) and manual installations.

DO NOT SCALE FROM DRAWING
The original of this drawing was produced in colour - a monochrome copy should not be relied upon.

REV.	DESCRIPTION	DWN	CHK'D	DATE		
/	Uses TOP as base layer	TB	AT	19/05/22		
CLIENT Wates Group						
PROJECT 220286/A1 New Ysgol Plas Brondyffryn, Denbigh Leisure, Clywd Avenue, Denbigh, LL16 3HB						
TITLE Tree Protection Plan						
DWN	DATE	CHK'D	DATE	APP'D	DATE	SCALE
RCK	01/04/2022	TB	01/04/2022			1:500
 (Mail) Second Floor, 1 Hunter's Walk, Canal Street, Chester, CH1 4EB Telephone: 0333 123 7080 www.indigosurveys.co.uk						
Drawing Number 220286/A1/TPP/01					REV.	A1
THIS DRAWING IS CONFIDENTIAL AND MUST NOT BE REPRODUCED WITHOUT THE CONSENT OF INDIGO SURVEYS LTD.						